

## Attachment 8

## TREE INVENTORY TABLE

#	Scientific Name	Common Name	Location	DBH (cm)	DAB (cm)	Crown (m)	Condition Rating	Structural & Biological Condition Notes	Native Status	Tree Action	Minimum Protectio Distance Required (m)
1	Acer platanoides	Norway Maple	municipal right-of-way	18.5, 11	32	8	Good		non-native	Remove	NA
2	Juglans nirga	Black Walnut	municipal right-of-way	21.5	27	8	Good	good form, even crown	native	Remove	NA
3	Picea glauca	White Spruce	municipal right-of-way	43	64	9	Dead	no living needles present on tree	native	Potential Hazard, Remove	NA
4	Prunus sp.	Cherry	municipal right-of-way	14, 16.5	27	6	Fair	2 stems, one stem with major storm damage (missing canopy), tree leans west, old LDD moth egg masses present	native genus	Remove	NA
5	Acer saccharum	Sugar Maple	municipal right-of-way	15.5, 6	33	7	Good-Fair	one stem pruned at base, 2 stub cuts in canopy	native	Preserve	1.8
6	Acer saccharum	Sugar Maple	CP Railway	19.5	25	6	Good-Fair	multiple leaders	native	Preserve	1.8
	Juglans nirga	Black Walnut	CP Railway	24.5	31	9	Good-Fair	high canopy, 3 small dead branches in lower canopy, co- dominant leaders	native	Remove	NA
	Acer platanoides	Norway Maple	private property, edge of tree line	20	26	7	Good	co-dominant leaders	non-native	Remove	NA
9	Acer platanoides	Norway Maple	CP Railway	20	26	7	Good	co-dominant leaders	non-native	Preserve	1.8
10	Malus sp.	Apple Tree	CP Railway	12.5, 26	37	9	Fair	1 dead limb (~10cm cal)	non-native genus	Preserve	2.4
11	Acer platanoides	Norway Maple	private property, edge of tree line	23	30	10	Good	2 dead branches in lower canopy	non-native	Remove	NA
12	Acer platanoides	Norway Maple	private property, edge of tree line	21.5	26	10	Good	crooked trunk	native	Remove	NA
13	Betula papyrifera	Paper Birch	private property	18	24	6	Fair	uneven canopy, canopy grows mostly on north side of tree, co-dominant leaders	native	Remove	NA
14	Acer platanoides	Norway Maple	private property	24.5	27	10	Good-Fair	poor form, 1 dead limb (~ 8 cal lower canopy)	non-native	Remove	NA
15	Acer platanoides	Norway Maple	private property	25	32	9	Good	good form, even crown	non-native	Remove	NA
16	Picea glauca	White Spruce	private property	57	80	11	Fair	thin lower crown, partially healed trunk wound at base extending ~2m up trunk	native	Remove	NA



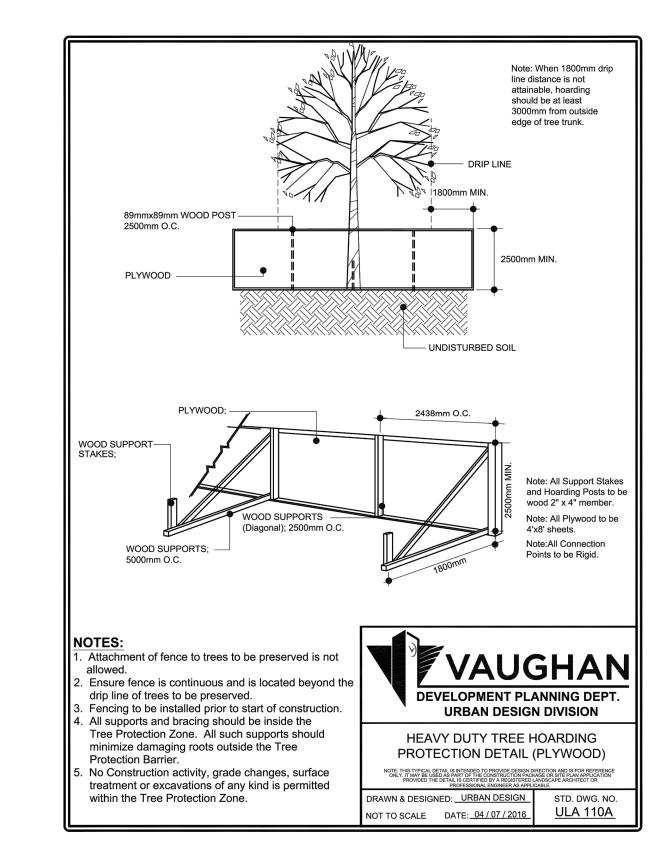

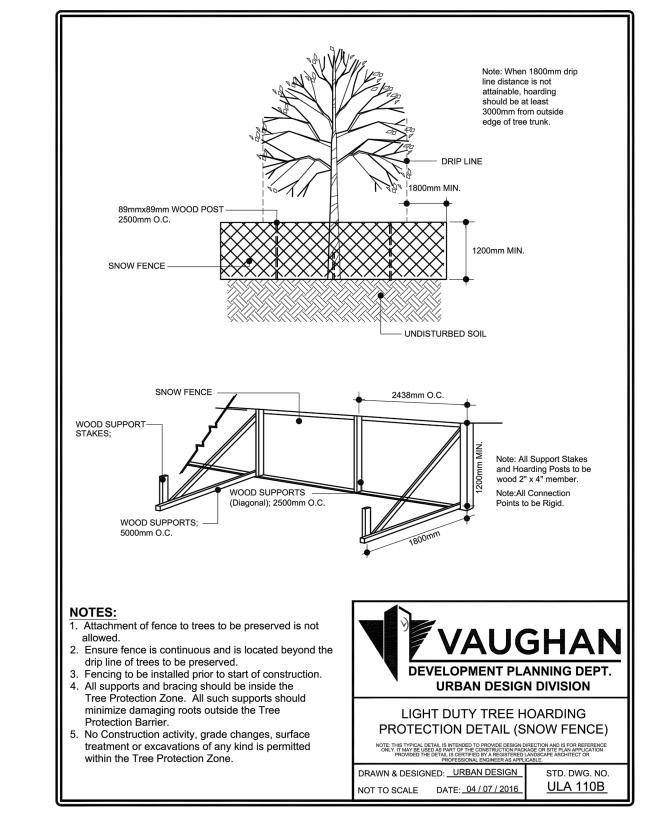

Toronto ON M6K QP6
p+1 416 236 3335 | f+1 866 496 0239 |

CLIENT
WESTON CONSULTING VAUGHAN
TEAM
ARCHITECT:

TEAM
ARCHITECT:
STRUCTURAL:
MECHANICAL:
CIVIL:
ELECTRICAL:
TRANSPORTATION:
IRRIGATION:

LEGEND

GENERAL NOTES

EXISTING TREE TO REMAIN AND PROTECT



RECOMMENDED TREE REMOVAL

TREE HOARDING

(PER CITY OF VAUGHAN STANDARD)

PROPERTY LINE

EXTENT OF UNDERGROUND PARKING,
RETAINING WALLS AND DRIVEWAY

PROPOSED SERVICING WITHIN TREE
DRIPLINE AREA

NOTE: TREE INVENTORY CONDUCTED BY ISA CERTIFIED ARBORIST, JILLIAN ALBERT ON MARCH 14, 2023. LOCATIONS OF TREES NOT LOCATED ON THE SURVEY ARE APPROXIMATE.

04	SUBMISSION TO CITY	2024 12 20
03	SUBMISSION FOR COORDINATION	2023 06 15
02	SUBMISSION FOR CLIENT REVIEW	2023 05 04
01	SUBMISSION FOR CLIENT REVIEW	2023 03 17
NO.	REVISIONS	DATE

PROJECT:
239-251 WOODBRIDGE AVE

TITLE:

TREE PROTECTION PLAN

PROJECT NO: 23006
SCALE: 1:150
DRAWN BY: JA
REVIEWED BY: NT
PRINT DATE: 12/23/2024

WOODBRIDGE, ON

